

Installation Instructions:

Installing a PPC CMP6-OR-S F Type Connector

Step 1)

Strip 5mm of Jacket (Usually Black PVC) Shield (Braded Shielding and Aluminum Foil) and Dielectric (White gas injected PE foam) of the cable leaving only the center conductor sticking out.

Step 2)

Strip 5mm of the Jacket only.

Step 3)


Fold the braded shield over the Jacket, Do not do anything with the bonded foil shield.

Step 4)

Check there are no loose wires that could cause a short between the center conductor and the Shield.

Step 5)

Push on the F Type Connector.

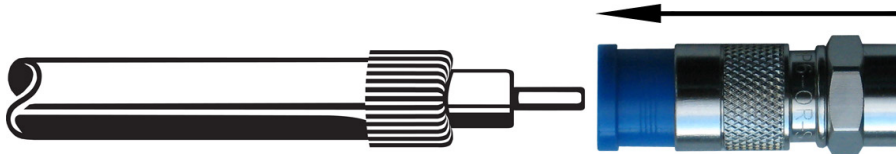

Step 6)

Hold the PPC Linear Compression tool and push the lever down.

